


Turning toolholders external



Right hand shown

Unit mm

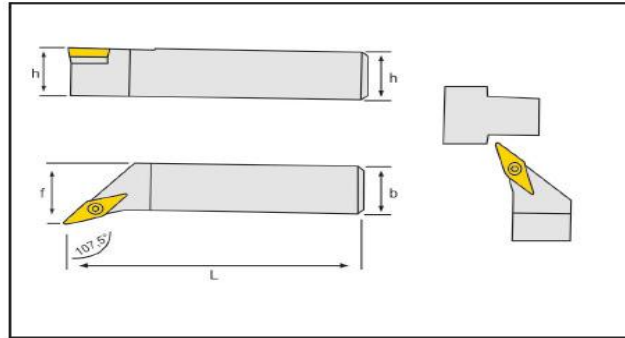

		Dimensions						
Application	Insert	Order code	Part code	h	b	l1	f1	Master insert
107.5°	11	J147.12.12.80.11.1	SVHBR 1212 F11	12	12	80	16	VBMT 1103
		J147.16.16.100.11.1	SVHBR 1616 H11	16	16	100	20	VBMT 1103
		J147.20.20.125.11.1	SVHBR 2020 K11	20	20	125	25	VBMT 1103
	16	J147.20.20.125.16.1	SVHBR 2020 K16	20	20	125	25	VBMT 1604
		J147.25.25.150.16.1	SVHBR 2525 M16	25	25	150	32	VBMT 1604
		J147.32.32.170.16.1	SVHBR 3232 P16	32	32	170	40	VBMT 1604
107.5°	11	J147.12.12.80.11.2	SVHBL 1212 F11	12	12	80	16	VBMT 1103
		J147.16.16.100.11.2	SVHBL 1616 H11	16	16	100	20	VBMT 1103
		J147.20.20.125.11.2	SVHBL 2020 K11	20	20	125	25	VBMT 1103
	16	J147.20.20.125.16.2	SVHBL 2020 K16	20	20	125	25	VBMT 1604
		J147.25.25.150.16.2	SVHBL 2525 M16	25	25	150	32	VBMT 1604
		J147.32.32.170.16.2	SVHBL 3232 P16	32	32	170	40	VBMT 1604

Spare parts, parts included in delivery

Designation	Clamp	Clamping screw	Wrench	Shim	Shim screw	Spring
1212..		CS95 (M2,5)	W95.1 (T8)			
1616..		CS95 (M2,5)	W95.1 (T8)			
VBMT 11..		CS95 (M2,5)	W95.1 (T8)			
VBMT 16..		CS96 (M3,5)	W96.1 (T15)	SVB.16	SS101 (M5)	

Please check availability in current price and stock list