


## Turning toolholders external



Right hand shown

Unit mm

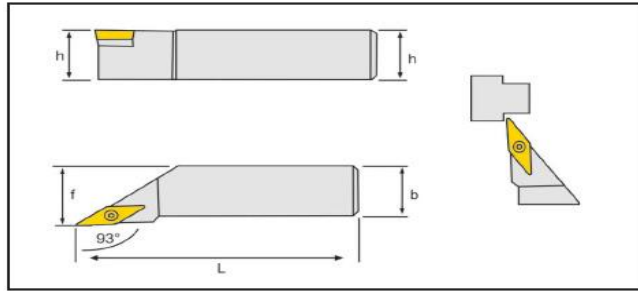

Application	Insert	Order code	Part code	Dimensions				Master insert	
				h	b	l <sub>1</sub>	f <sub>1</sub>		
93°	11	<b>J143.12.12.80.11.1</b>	SVJBR 1212 F11	12	12	80	16	VBMT 1103	
		<b>J143.16.16.100.11.1</b>	SVJBR 1616 H11	16	16	100	20	VBMT 1103	
		<b>J143.20.20.125.11.1</b>	SVJBR 2020 K11	20	20	125	25	VBMT 1103	
	16	<b>J143.20.20.125.16.1</b>	SVJBR 2020 K16	20	20	125	25	VBMT 1604	
		<b>J143.25.25.150.16.1</b>	SVJBR 2525 M16	25	25	150	32	VBMT 1604	
		<b>J143.32.32.170.16.1</b>	SVJBR 3232 P16	32	32	170	40	VBMT 1604	
	93°	11	<b>J143.12.12.80.11.2</b>	SVJBL 1212 F11	12	12	80	16	VBMT 1103
			<b>J143.16.16.100.11.2</b>	SVJBL 1616 H11	16	16	100	20	VBMT 1103
			<b>J143.20.20.125.11.2</b>	SVJBL 2020 K11	20	20	125	25	VBMT 1103
16		<b>J143.20.20.125.16.2</b>	SVJBL 2020 K16	20	20	125	25	VBMT 1604	
		<b>J143.25.25.150.16.2</b>	SVJBL 2525 M16	25	25	150	32	VBMT 1604	
		<b>J143.32.32.170.16.2</b>	SVJBL 3232 P16	32	32	170	40	VBMT 1604	

Spare parts, parts included in delivery

Designation	Clamp	Clamping screw	Wrench	Shim	Shim screw	Spring
1212..		CS95 (M2,5)	W95.1 (T8)			
1616..		CS95 (M2,5)	W95.1 (T8)			
VBMT 11..		CS96 (M3,5)	W96.1 (T15)			
VBMT 16..		CS96 (M3,5)	W96.1 (T15)	SVB.16	SS101 (M5)	

Please check availability in current price and stock list